MOUNTING INSTRUCTIONS FOR TYPE -13

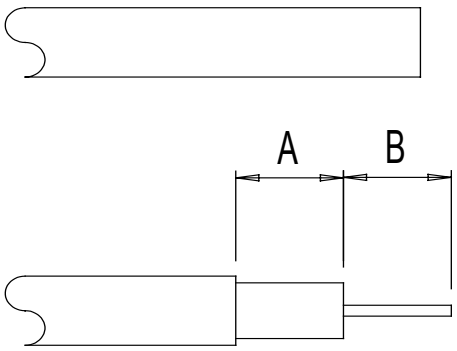

STEP 1

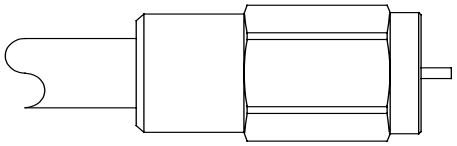

STEP 2

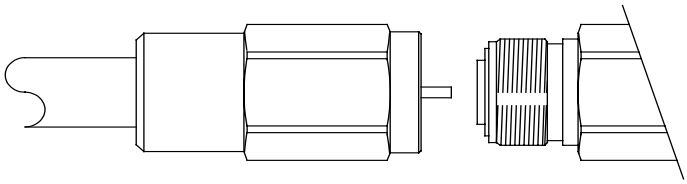

STEP 3

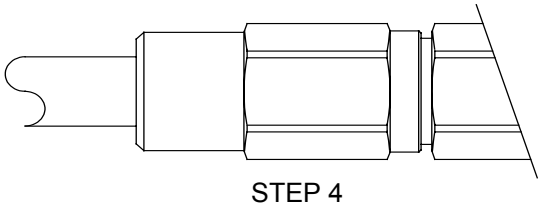

STEP 4

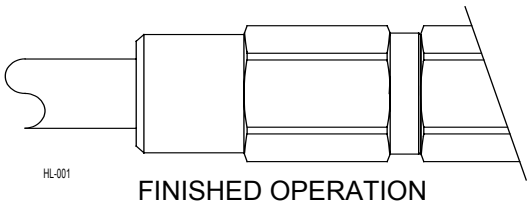

FINISHED OPERATION

STEP 1

Use a Stanley-knife (or similar) for the stripping operation.

A. Cut and remove the jacket, outer conductor and dielectric from the inner conductor in one operation to obtain dimension "B" (exposed inner conductor).

B. If necessary, clean the inner conductor using a conductor cleaner (item no 98500900), or another other proper tools.

C. Cut and remove the jacket to obtain dimension "A". Please make sure, not to damage the outer conductor during this operation.

After completed operation, the outer conductor must be smooth and the prepared cable dimensions should be as follows:

A = 10.0 mm.
B = 12.0 mm.

STEP 2

Place the back nut over the cable and push it backward to reach mechanical stop.

STEP 3

Push the connector front part and the cable (with the back-nut) together by hand. During this operation the inner conductor of the cable slips into the centre seizing mechanism of the front part.

STEP 4

Tighten the back-nut by hand as far as possible. Then tighten the back-nut to positive stop by use of two spanners. Keep the body in place during the operation.

Size of open-ended spanners: 20 mm (for main-nut and body).

ISO 9001 certified

Distributor:

CABELCON connectors

Corning Cabelcon ApS, Industriparken 10, DK 4760 Vordingborg
Tel: +45 55 98 55 99 · Fax: + 45 55 98 55 04
E-mail: cabelcon@cabelcon.dk · www.cabelcon.dk